

ALL 2015 FZ-07 MODELS  
FACTORY MODIFICATION CAMPAIGN – Positive Battery Cable  
Yamaha Technical Bulletin M2014-018R

**Affected Models:**

2015 FZ07F  
RM06E - 000002 ~ 0002606  
2015 FZ07FC  
RM06Y - 000008 ~ 0000734

**The reason for this recall:**

In affected motorcycles, there is a possibility for the positive (red) battery cable to be pinched between the seat base and seat bracket due to inappropriate length of the battery cable and the shape of the seat bracket. If this happens, the positive battery cable's insulation may be chafed away over time, resulting in sparks, increasing the risk of fire.

**What Yamaha and your dealer will do:**

To correct this defect, your authorized Yamaha dealer will replace the positive battery cable and seat bracket with new ones of a different design and add a revision sticker to your Owner's Manual to show the new positive battery cable routing. The procedure takes about 45 minutes to perform, but your dealer may need to keep your motorcycle longer depending upon their schedule. There will be no charge to you for this procedure.

**What you should do now:**

Please call your Yamaha dealer to make a service appointment to have this procedure performed. At that same time, you can find out how long they expect to keep your motorcycle for this service. Remember to bring your Owner's Manual and, if possible, a copy of this notice with you when you take in your motorcycle. You should not ride your motorcycle until this modification is performed. If you are unable to return to the Yamaha dealer who sold you the motorcycle, this service will be performed by any authorized Yamaha Motorcycle dealer. For the name of a dealer near you, call 1-800-88-YAMAHA or visit the "Find a Dealer" section of this website.